


SealSmart
Compression Connectors

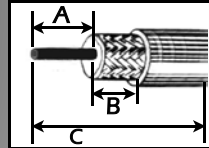

Color Code		Connector Type	Stripping Dimensions		
Cable	Color		A	B	C
RG59	RED	'F'	.311"	.236"	N/A
RG6	BLACK	RCA	.177"	.236"	1.0"
RG6Q	BLUE	BNC	.177"	.236"	1.0"



PLATINUM TOOLS

www.platinumtools.com

Ph: 805.532.0145

Instruction Sheet Compression Connectors

SealSmart

Cable Preparation & Termination

1. Connectors are color coded for cable type. See chart.
2. Strip cable to dimensions shown on chart. Remove cable jacket and dielectric.
3. Fold exposed braid back over cable jacket leaving smooth foil attached to dielectric.
4. For Quad Shield Cable: Fold outer braid back over jacket, remove outer foil and fold inner braid back over jacket.
5. Trim center conductor to proper length, see (A) dimension.
6. Insert cable into rear of connector. Insertion depth is shown on chart. For *F* connectors, dielectric should be flush with support mandrel face.
7. Crimp until compression ring is fully seated in connector body.

Tips & Tricks



- The key to a good crimp is proper cable & connector preparation.
- Using the proper tools makes the job go faster with more reliable results.

© Platinum Tools, Inc. 2003